

---

# Radon Inspection Report

---

**Test Location:**

Silverton Middle School  
714 Schlador St.  
Silverton, OR 97381

**Test For:****Inspected By:**

12839 NE Airport Way  
Portland, OR 97230  
503-421-4813

Bldg. Type: Educational

Type: Post-Mitigation

---

## Test Result: Pass

**Overall Average:**

**1.8 pCi/l**

**EPA Average:**

**1.8 pCi/l**

---

**Test Device Details:**

Serial Number: 238738013  
Model Number: 1028XP  
Last Calibration: 02/06/2019  
Next Calibration: 02/06/2020  
Cal-Factors: 3.02  
Motion Error: Yes

**Test Site Condition:**

Structure Type: Middle School  
Mitigation Sys: Installed and Active

**Test Summary:**

<u>CRM Location:</u>	<u>Start:</u>	<u>Stop:</u>	<u>Interval:</u>	<u>Duration:</u>
Boy's Locker room	11/18/2019 10:48 AM	11/22/2019 03:48 PM	1 hr	101 hr

<u>*First 4 hrs of data excluded</u>	<u>Min:</u>	<u>Max:</u>	<u>Average:</u>	<u>Measurement Units:</u>
Radon Concentration:	0.0	5.3	1.8	pCi/l


---

**Comments:**

Lic/Cert Signature

Inspection Report Date: 11/25/2019

### Radon Inspection Chart

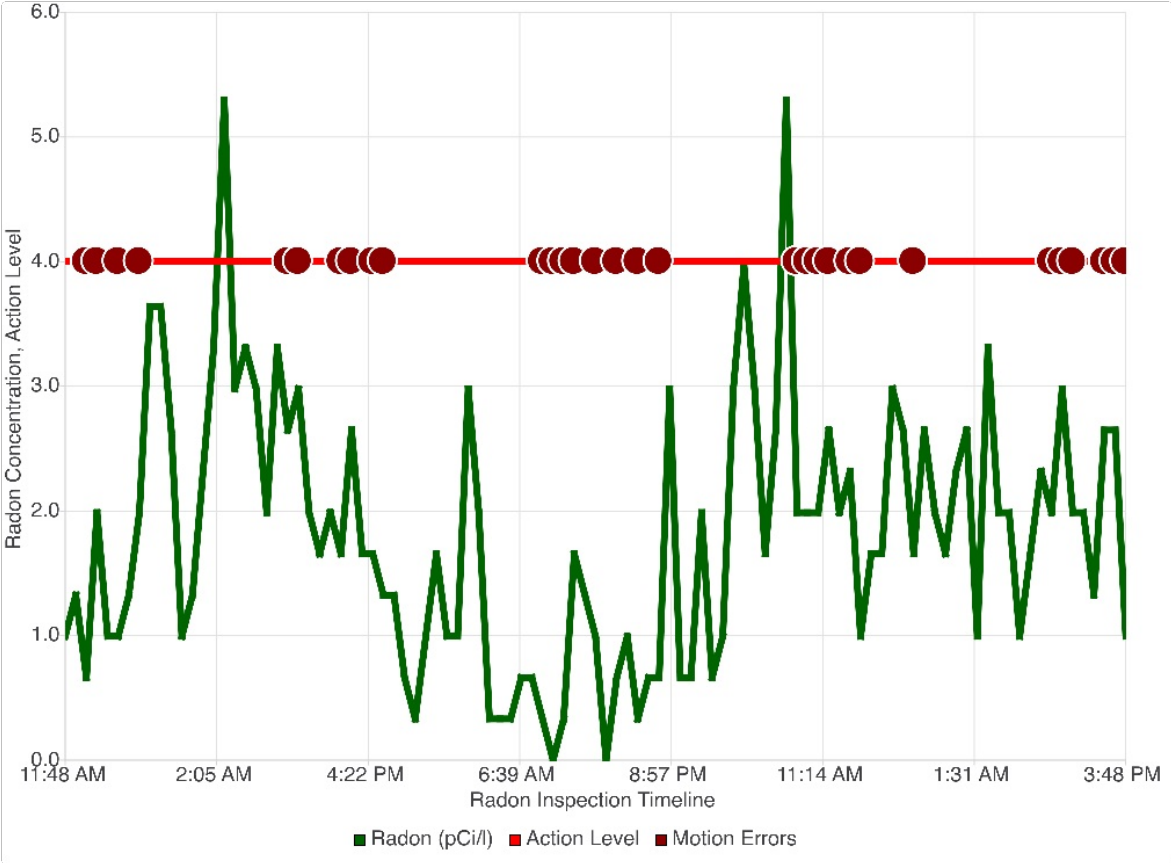

**Test Result: Pass**

**Test Location:** 714 Schlador St. Silverton, OR 97381

**Inspection Report Date:** 11/25/2019

---

## Test Table

\* Data from first 4 hours excluded from EPA calculations

---

<u>Date/Time</u>	<u>Radon(pCi/l)</u>	<u>Flags</u>
11/18/19 11:48 AM	1.0	-
11/18/19 12:48 PM	1.3	-
11/18/19 01:48 PM	0.7	M
11/18/19 02:48 PM	2.0	M
11/18/19 03:48 PM	1.0	-
11/18/19 04:48 PM	1.0	M
11/18/19 05:48 PM	1.3	-
11/18/19 06:48 PM	2.0	M
11/18/19 07:48 PM	3.6	-
11/18/19 08:48 PM	3.6	-
11/18/19 09:48 PM	2.6	-
11/18/19 10:48 PM	1.0	-
11/18/19 11:48 PM	1.3	-
11/19/19 12:48 AM	2.3	-
11/19/19 01:48 AM	3.3	-
11/19/19 02:48 AM	5.3	-
11/19/19 03:48 AM	3.0	-
11/19/19 04:48 AM	3.3	-
11/19/19 05:48 AM	3.0	-
11/19/19 06:48 AM	2.0	-
11/19/19 07:48 AM	3.3	-
11/19/19 08:48 AM	2.6	M
11/19/19 09:48 AM	3.0	M
11/19/19 10:48 AM	2.0	-
11/19/19 11:48 AM	1.7	-
11/19/19 12:48 PM	2.0	-
11/19/19 01:48 PM	1.7	M
11/19/19 02:48 PM	2.6	M
11/19/19 03:48 PM	1.7	-
11/19/19 04:48 PM	1.7	M
11/19/19 05:48 PM	1.3	M
11/19/19 06:48 PM	1.3	-
11/19/19 07:48 PM	0.7	-
11/19/19 08:48 PM	0.3	-
11/19/19 09:48 PM	1.0	-
11/19/19 10:48 PM	1.7	-
11/19/19 11:48 PM	1.0	-
11/20/19 12:48 AM	1.0	-
11/20/19 01:48 AM	3.0	-
11/20/19 02:48 AM	2.0	-
11/20/19 03:48 AM	0.3	-
11/20/19 04:48 AM	0.3	-
11/20/19 05:48 AM	0.3	-
11/20/19 06:48 AM	0.7	-

---

### Test Result: Pass

Test Location: 714 Schlador St. Silverton, OR 97381

Inspection Report Date: 11/25/2019

---

---

## Test Table

\* Data from first 4 hours excluded from EPA calculations

---

Date/Time	Radon(pCi/l)	Flags
11/20/19 07:48 AM	0.7	-
11/20/19 08:48 AM	0.3	M
11/20/19 09:48 AM	0.0	M
11/20/19 10:48 AM	0.3	M
11/20/19 11:48 AM	1.7	M
11/20/19 12:48 PM	1.3	-
11/20/19 01:48 PM	1.0	M
11/20/19 02:48 PM	0.0	-
11/20/19 03:48 PM	0.7	M
11/20/19 04:48 PM	1.0	-
11/20/19 05:48 PM	0.3	M
11/20/19 06:48 PM	0.7	-
11/20/19 07:48 PM	0.7	M
11/20/19 08:48 PM	3.0	-
11/20/19 09:48 PM	0.7	-
11/20/19 10:48 PM	0.7	-
11/20/19 11:48 PM	2.0	-
11/21/19 12:48 AM	0.7	-
11/21/19 01:48 AM	1.0	-
11/21/19 02:48 AM	3.0	-
11/21/19 03:48 AM	4.0	-
11/21/19 04:48 AM	3.0	-
11/21/19 05:48 AM	1.7	-
11/21/19 06:48 AM	2.6	-
11/21/19 07:48 AM	5.3	-
11/21/19 08:48 AM	2.0	M
11/21/19 09:48 AM	2.0	M
11/21/19 10:48 AM	2.0	M
11/21/19 11:48 AM	2.6	M
11/21/19 12:48 PM	2.0	-
11/21/19 01:48 PM	2.3	M
11/21/19 02:48 PM	1.0	M
11/21/19 03:48 PM	1.7	-
11/21/19 04:48 PM	1.7	-
11/21/19 05:48 PM	3.0	-
11/21/19 06:48 PM	2.6	-
11/21/19 07:48 PM	1.7	M
11/21/19 08:48 PM	2.6	-
11/21/19 09:48 PM	2.0	-
11/21/19 10:48 PM	1.7	-
11/21/19 11:48 PM	2.3	-
11/22/19 12:48 AM	2.6	-
11/22/19 01:48 AM	1.0	-
11/22/19 02:48 AM	3.3	-

---

### Test Result: Pass

Test Location: 714 Schlador St. Silverton, OR 97381

Inspection Report Date: 11/25/2019

---

---

## Test Table

\* Data from first 4 hours excluded from EPA calculations

---

<u>Date/Time</u>	<u>Radon(pCi/l)</u>	<u>Flags</u>
11/22/19 03:48 AM	2.0	-
11/22/19 04:48 AM	2.0	-
11/22/19 05:48 AM	1.0	-
11/22/19 06:48 AM	1.7	-
11/22/19 07:48 AM	2.3	-
11/22/19 08:48 AM	2.0	M
11/22/19 09:48 AM	3.0	M
11/22/19 10:48 AM	2.0	M
11/22/19 11:48 AM	2.0	-
11/22/19 12:48 PM	1.3	-
11/22/19 01:48 PM	2.6	M
11/22/19 02:48 PM	2.6	M
11/22/19 03:48 PM	1.0	M

---

**Test Result: Pass**

**Test Location:** 714 Schlador St. Silverton, OR 97381

**Inspection Report Date:** 11/25/2019

---